

What are RTD Sensors? Why Use Them? How Do They Work?

What is an RTD?

Resistance Temperature Detectors (RTDs) are temperature sensors that contain a resistor that changes resistance value as its temperature changes. They have been used for many years to measure temperature in laboratory and industrial processes, and have developed a reputation for accuracy, repeatability, and stability.

Why use an RTD instead of a thermocouple or thermistor sensor?

Each type of temperature sensor has a particular set of conditions for which it is best suited. RTDs offer several advantages:

- A wide temperature range (approximately -200 to 850°C)
- Good accuracy (better than thermocouples)
- Good interchangeability
- Long-term stability

With a temperature range up to 850°C, RTDs can be used in all but the highest-temperature industrial processes. When made using metals such as platinum, they are very stable and are not affected by corrosion or oxidation.

Other materials such as nickel, copper, and nickel-iron alloy have also been used for RTDs. However, these materials are not commonly used since they have lower temperature capabilities and are not as stable or repeatable as platinum.

RTD standards

There are two standards for platinum RTDs: the European standard (also known as the DIN or IEC standard) and the American standard.

The **European standard**, also known as the DIN or IEC standard, is considered the world-wide standard for platinum RTDs. This standard, DIN/IEC 60751 (or simply IEC751), requires the RTD to have an electrical resistance of 100.00Ω at 0°C and a temperature coefficient of resistance (TCR) of 0.00385Ω/Ω/°C between 0 and 100°C.

There are two resistance tolerances specified in DIN/IEC751:

Class A = $\pm(0.15 + 0.002 \cdot t)$ °C or 100.00 ±0.06 Ω at 0°C
 Class B = $\pm(0.3 + 0.005 \cdot t)$ °C or 100.00 ±0.12 Ω at 0°C

Two resistance tolerances used in industry are:

$\frac{1}{2}$ DIN = $\pm\frac{1}{2} \cdot (0.3 + 0.005 \cdot t)$ °C or 100.00 ±0.10 Ω at 0°C
 $\frac{1}{10}$ DIN = $\pm\frac{1}{10} \cdot (0.3 + 0.005 \cdot t)$ °C or 100.00 ±0.03 Ω at 0°C

The combination of resistance tolerance and temperature coefficient define the resistance vs. temperature characteristics for the RTD sensor. The larger the element tolerance, the more the sensor will deviate from a generalised curve, and the more variation there will be from sensor to sensor (interchangeability). This is important to users who need to change or replace sensors and want to minimise interchangeability errors.

omega.co.uk features a resistance vs. temperature curve from -200 to 850°C with resistance values given for every degree Celsius. The following

interchangeability table shows how the tolerance and temperature coefficient affect the indicated temperature of the sensor in degrees Celsius:

Interchangeability in °C				
Temp °C	Class B	Class A	$\frac{1}{2}$ DIN	$\frac{1}{10}$ DIN
-200	1.30	—	—	—
-100	0.80	—	—	—
-50	0.55	0.25	0.18	—
0	0.30	0.15	0.10	0.03
100	0.80	0.35	0.27	0.08
200	1.30	0.55	0.43	—
250	1.55	0.65	0.52	—
300	1.80	0.75	—	—
350	2.05	0.85	—	—
400	2.30	0.95	—	—
450	2.55	1.05	—	—
500	2.80	—	—	—
600	3.30	—	—	—


At Omega, our standard RTD products are based on the European or IEC standard.

The **American standard**, used mostly in North America, has a resistance of 100.00 ±0.10 Ω at 0°C and a temperature coefficient of resistance (TCR) of 0.00392Ω/Ω/°C nominal (between 0 and 100°C).

omega.co.uk also includes a resistance vs. temperature curve from -100 to 457°C, with resistance values given every one degree Celsius.

At Omega, we provide the American standard as an option and designate it with an "A" in the model number.

Example: PR-10-2-M60-150-A

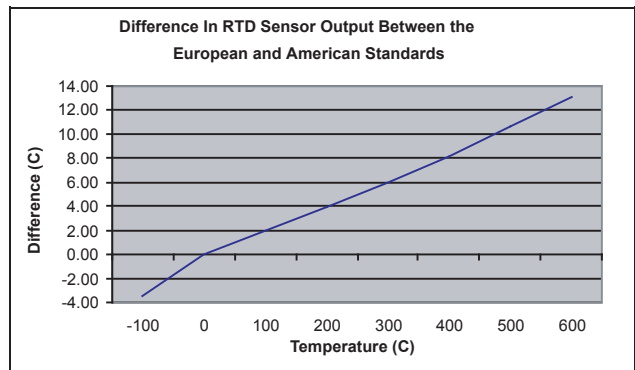

Other resistance value options

RTD elements can also be purchased with resistances of 200, 500, 1000, and 2000 Ω at 0°C. These RTDs have the same temperature coefficients as previously described, but because of their higher resistances at 0°C, they provide more resistance change per degree, allowing for greater resolution.

omega.co.uk[®]

Your One-Stop Source for Process Measurement and Control!

Freephone 0800 488 488 | International +44(0) 161 777 6622 | Fax +44(0) 161 777 6622 | Sales@omega.co.uk

www.omega.co.uk



UNITED STATES

www.omega.com

1-800-TC-OMEGA
Stamford, CT.

UNITED KINGDOM

www.omega.co.uk

Manchester, England
0800-488-488
+44-(0)161-777-6611

CANADA

www.omega.ca

Laval(Quebec)
1-800-TC-OMEGA

FRANCE

www.omega.fr

0800-466-342

GERMANY

www.omega.de

Deckenfronn, Germany
0800-8266342

BENELUX

www.omega.nl

0800-099-33-44



More than 100,000 Products Available!

• Temperature

Calibrators, Connectors, General Test and Measurement Instruments, Handheld Instruments for Temperature Measurement, Ice Point References, Indicating Labels, Crayons, Cements and Lacquers, Infrared Temperature Measurement Instruments, Recorders, Relative Humidity Measurement Instruments, PT100 Probes, PT100 Elements, Temperature & Process Meters, Timers and Counters, Temperature and Process Controllers and Power Switching Devices, Thermistor Elements, Probes and Assemblies, Thermocouples, Thermowells and Head and Well Assemblies, Transmitters, Thermocouple Wire, RTD Probes

• Flow and Level

Air Velocity Indicators, Doppler Flowmeters, Level Measurement, Magnetic Flowmeters, Mass Flowmeters, Pitot Tubes, Pumps, Rotameters, Turbine and Paddle Wheel Flowmeters, Ultrasonic Flowmeters, Valves, Variable Area Flowmeters, Vortex Shedding Flowmeters

• pH and Conductivity

Conductivity Instrumentation, Dissolved Oxygen Instrumentation, Environmental Instrumentation, pH Electrodes and Instruments, Water and Soil Analysis Instrumentation

• Data Acquisition

Communication Products and Converters, Data Acquisition and Analysis Software, Data Loggers Plug-in Cards, Signal Conditioners, USB, RS232, RS485, Ethernet and Parallel Port Data Acquisition Systems, Wireless Transmitters and Receivers

• Pressure, Strain and Force

Displacement Transducers, Dynamic Measurement Force Sensors, Instrumentation for Pressure and Strain Measurements, Load Cells, Pressure Gauges, Pressure Reference Section, Pressure Switches, Pressure Transducers, Proximity Transducers, Regulators, Pressure Transmitters, Strain Gauges, Torque Transducers, Valves

• Heaters

Band Heaters, Cartridge Heaters, Circulation Heaters, Comfort Heaters, Controllers, Meters and Switching Devices, Flexible Heaters, General Test and Measurement Instruments, Heater Hook-up Wire, Heating Cable Systems, Immersion Heaters, Process Air and Duct, Heaters, Radiant Heaters, Strip Heaters, Tubular Heaters